
SERVICE BULLETIN # 1012

SUBJECT Governor Wire Installation


MODEL **Attachments** DATE 2-5-58

When the governor was first introduced on the Brushcutter Attachment, its wire assembly, part number 52149, was assembled so that it passed over the head of the housing retaining screw, part number 101982, on the side closest to the muffler, part number 36932.

It was discovered that heat from the muffler quickly burned through the insulation on the wire causing grounding of the wire and stopping of the engine.

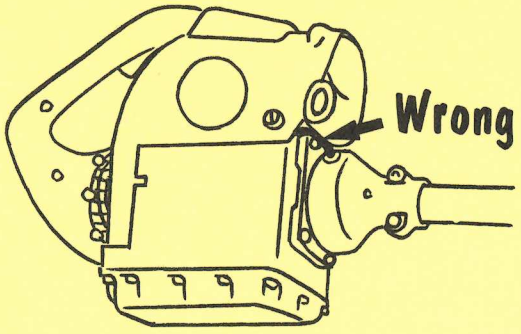

To correct this condition, the governor wire is now passed under the retaining screw head on the side away from the muffler. It is suggested that any Brushcutter attachments received with the governor wire passing over the retaining screw head should have this condition corrected.

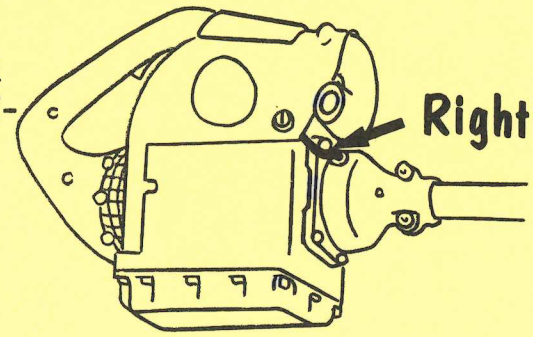

LITHO IN U.S.A.