
McCULLOCH SERVICE BULLETIN #1012A

MODEL BRUSHCUTTER DATE 7-25-58

SUBJECT: IMPROVEMENT OF GOVERNOR WIRE INSTALLATION

Service Bulletin #1012 described a method of preventing muffler heat from burning through the governor wire insulation. In some instances, however, this method is not successful.

Earl Pearson of Power Tools, Inc., in St. Paul, Minnesota, has suggested an improvement upon the technique described in Service Bulletin #1012. He suggests that a Clip, P/N 18645A, be attached to the right corner hold down screw of the transmission, and the governor wire passed through the clip. Use of the clip will eliminate any possibility of the wire slipping over the screw head and making contact with the hot muffler.

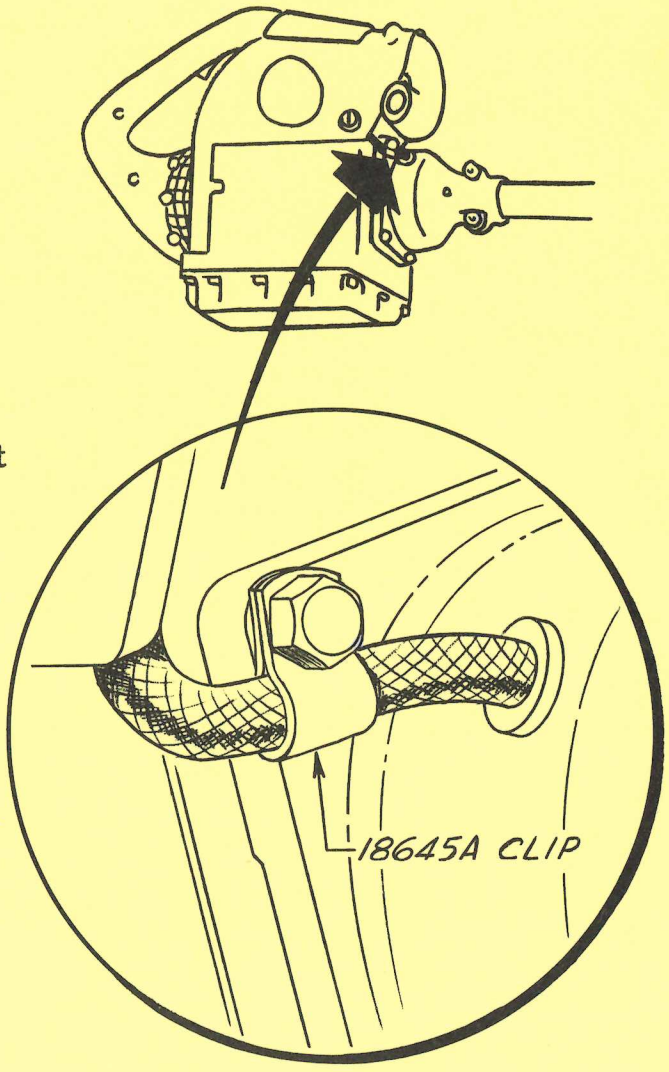

LITHO IN U.S.A.