McCULLOCH

SERVICE BULLETIN # 1038


SUBJECT NEW OIL PUMP SPRING

MODEL **MAC35A** S33, 33B, 35, 39 and Mac 35

DATE 10/30/58

A new oil-pump piston-return spring, P/N 36421, is now installed on Mac 35A engines. This new spring eliminates the need for the check-valve ball-retainer, P/N 36161, which was used with the earlier piston return spring, P/N 19236, in all 33 Series saws previous to the Mac 35A.

The last coil on the check-ball end of this new spring is formed into a smaller loop which firmly holds the check-ball on its seat. When assembling the new spring into the oil pump chamber in earlier 33 Series saws, special care should be taken to have the smaller coil flat so that it exerts direct pressure against the ball on its seat.

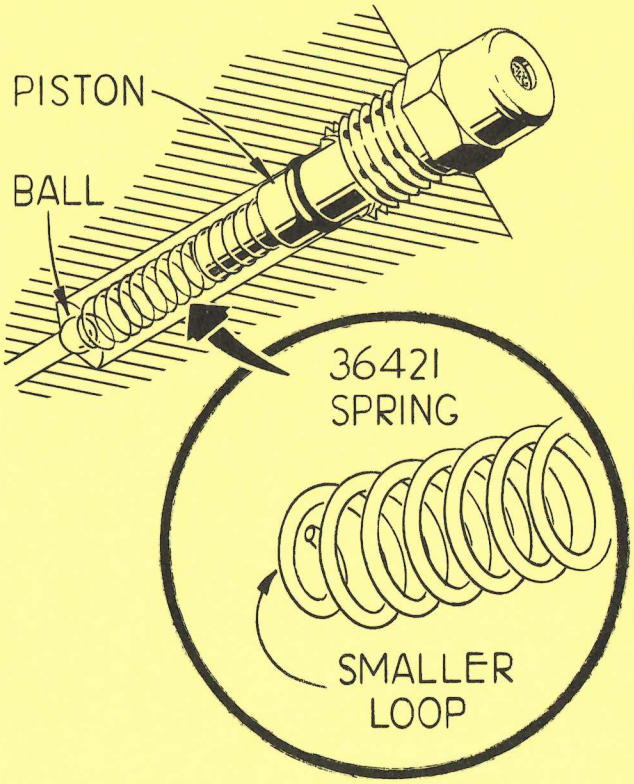

Particular care should also be taken to have the upper end of the spring fit freely over the pump piston, P/N 36126, so that the return action of the piston will not be restricted.

© 1958 McCULLOCH CORPORATION

LITHO IN U.S.A.