McCULLOCH

SERVICE BULLETIN # 1081

MODEL 1-70


DATE 1/6/60

SUBJECT: CHAIN OIL LEAKAGE FROM BAR MOUNT INTERFERENCE

If chain oil leakage occurs between the bar and the bar mounting pad on the chain oiler housing, replace the original fillister head screw, P/N 102219, 8-32 x 1/4, with a round head screw, P/N 101101, 8-32 x 1/4.

Because of accumulated tolerances, the fillister head screw may extend beyond the surface level of the mounting pad and prevent correct mounting of the bar on the mounting pad. This will permit oil to leak between the bar and oiler housing, will prevent proper chain lubrication, and cause excessive chain wear. Replacement of the fillister head screw with the round head screw will correct the oil leakage.

NOTE: As a preventative measure, check all Model 1-70 engines and all Oiler Housing Assemblies, P/N 51938, in your stock and install the round head screw if required.

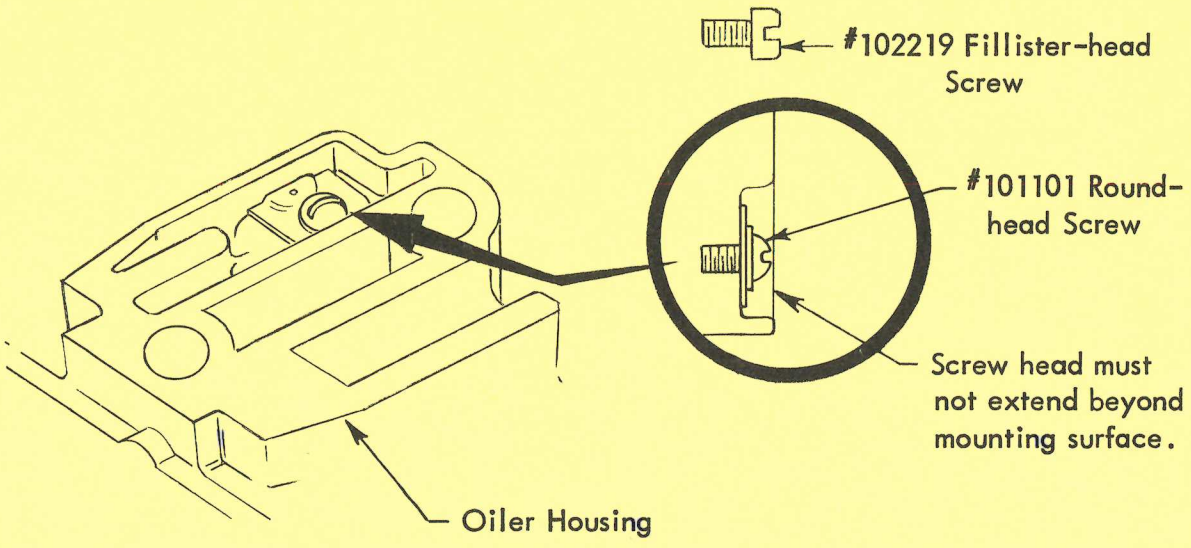

COPYRIGHT 1960 McCULLOCH CORPORATION

LITHO IN U.S.A.