McCULLOCH


SERVICE BULLETIN # 1094

MODEL 1-80, 1-60 DATE 2/4/60


SUBJECT NEW GEARCASE GASKET

To prevent loosening of the transmission assemblies on Model 1-80 and 1-60 engines due to gasket shrinkage, a new, thin Gearcase Gasket, P/N 51635A, is available for service replacement. The new gasket replaces the thicker 51635 gasket.

The modified design of the new gasket permits metal-to-metal contact at the three bolt locations on the gearcase. It's thickness, .004 inch, is not sufficient to cause a dangerous stress across the mounting area when the bolts are tightened. The new gasket is of high rag content paper which provides an excellent seal and good compressive strength.

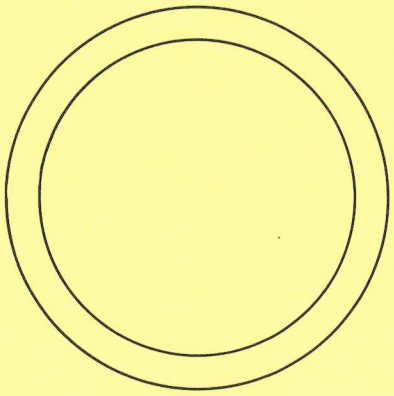

NEW 51635A GASKET

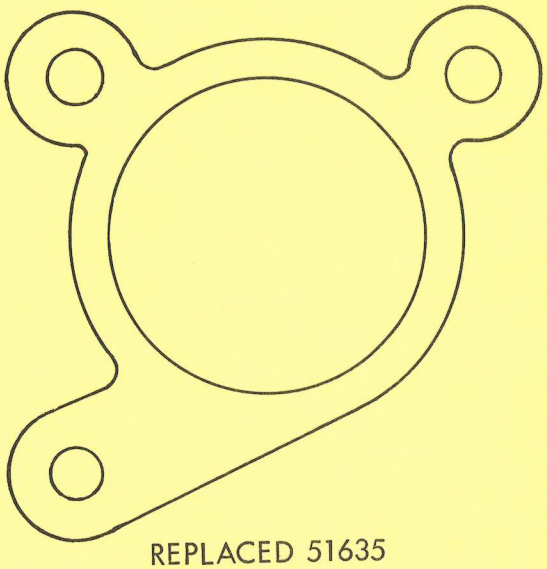

REPLACED 51635 GASKET

COPYRIGHT 1960 McCULLOCH CORPORATION

LITHO IN U.S.A.