McCULLOCH

SERVICE BULLETIN # 1095

MODEL 1-70, 1-80, S44A, S44, S55A, S55

DATE 5/13/60

SUBJECT NEW COIL AND TERMINAL ASSEMBLY P/N 55683

To improve the sealing of the spark plug wire and eliminate breakage in the coil housing, a new Coil and Terminal Assembly, P/N 55683, replaces the earlier Coil and Terminal Assembly, P/N 55014. Due to the design changes in the coil housing of the new Coil and Terminal Assembly, a modified Governor Arm Assembly, P/N 52498A, which replaces the earlier Governor Arm Assembly, P/N 52498, has been made available for service replacement.

When installing the new Coil and Terminal Assembly on saws which contain the earlier 52498 Governor Arm Assembly, cut off one corner of the governor vane as shown in Figure 1. This will prevent interference between the governor vane and the coil housing.

NOTE

Model S44 and S55 engines contain a 51389A Governor Arm Assembly, which has a different vane than the one used on the 52498 Assembly. Cut off 1/4-inch of the vane as shown in Figure 2.

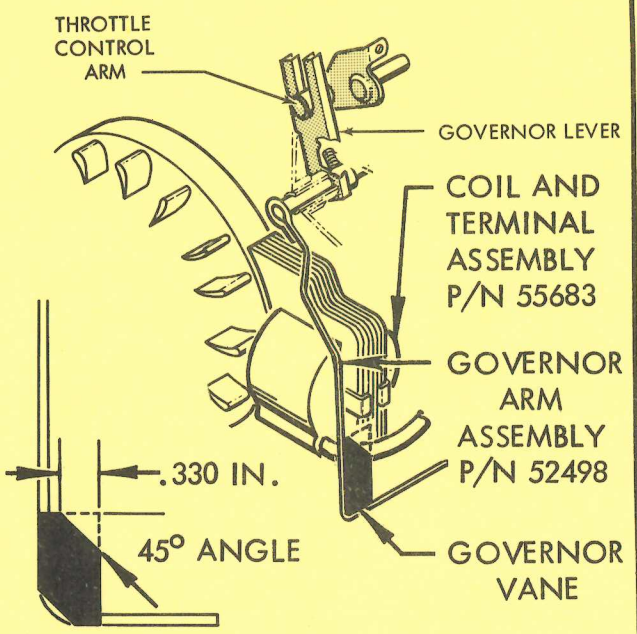


Figure 1.

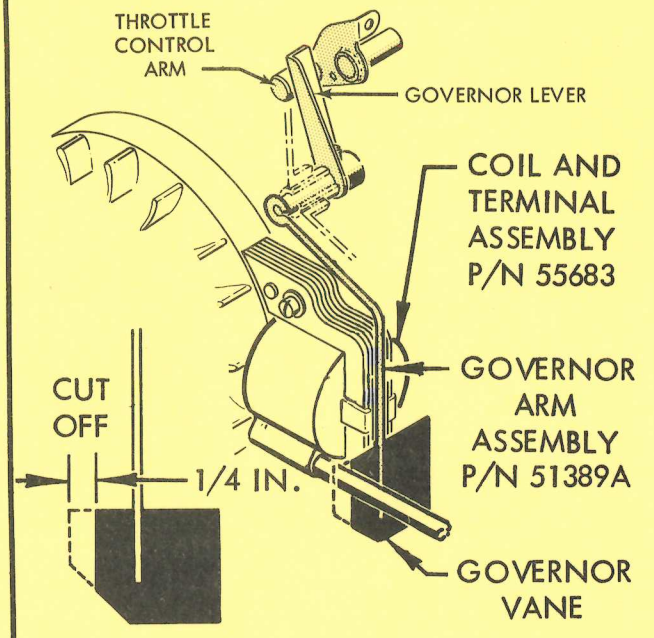


Figure 2.

COPYRIGHT 1960 McCULLOCH CORPORATION

LITHO IN U.S.A.