McCULLOCH

SERVICE BULLETIN #1119

MODEL 99


DATE 1/13/61

SUBJECT SHIM (TRANSMISSION TO CRANKCASE COVER)

This Bulletin is a Revision of Service Bulletin #224

To provide longer service life for the clutch assembly, install a Transmission Shim, P/N 24790, between the transmission assembly and the crankcase cover. The mating surfaces on the transmission assembly and the crankcase cover are subject to wear. If the mating surface wear becomes excessive, causing misalignment, cutting will be more difficult and early clutch failure can result.

Installation of the Transmission Shim, P/N 24790, will correct the alignment of the two mating surfaces if they are loose or worn.

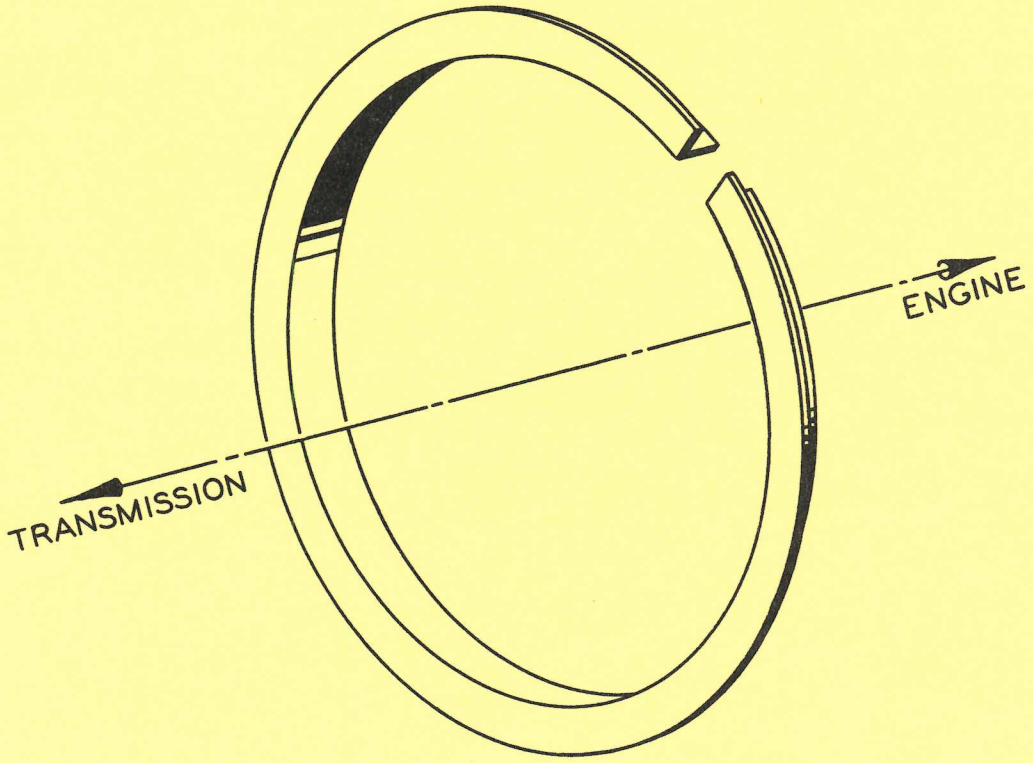

COPYRIGHT 1961 McCULLOCH CORPORATION

LITHO IN U.S.A.