McCULLOCH

SERVICE BULLETIN #1156


SUBJECT STARTER ASSEMBLY, P/N 55129C

MODEL 1-62, 1-82, 1-85 DATE 1-16-62

Due to an inadvertent shift in dimensional tolerances between the Starter Drum, P/N 55871, and the Starter Shaft, P/N 55110, a limited quantity of Starter Assemblies, P/N 55129C, were assembled with a second Washer, P/N 104457, installed under the roll pin.

If the second washer is not in place, the ratchet end of the starter shaft may possibly bottom on the clutch rotor assembly.

Thus, when servicing the starter assembly, carefully check the number of washers used and replace accordingly.

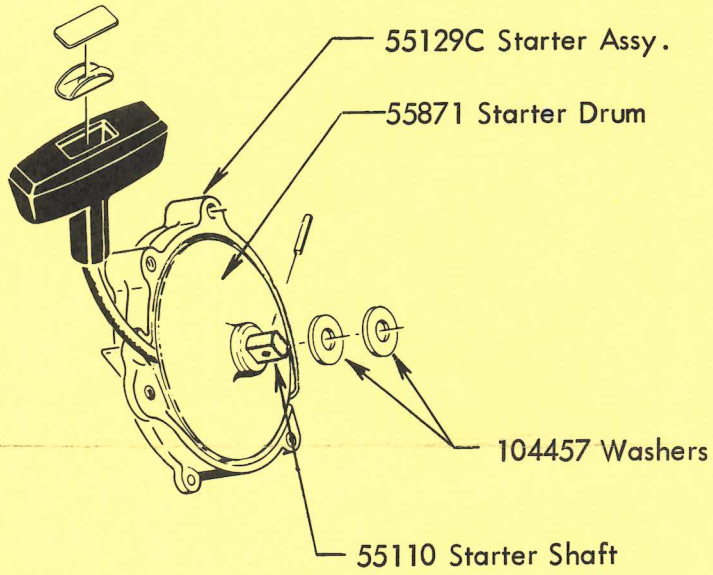

COPYRIGHT 1962 McCULLOCH CORPORATION

LITHO IN U.S.A.