McCULLOCH

SERVICE BULLETIN # 1165

SUBJECT CRANKCASE COVER ASSEMBLIES, P/N 57126 AND P/N 57126A

MODEL MC-1, MC-2, MC-7, 1-42, 1-45, 1-52, 1-62 DATE 3/19/62

Crankcase Cover Assembly, P/N 57126, listed in the Illustrated Parts List as the service replacement for the MC-1, MC-2, MC-7, 1-42, 1-45, 1-52, 1-62 model engines, MUST NOT be used on the MC-2 or MC-7 kart engines!

The MC-2 and MC-7 engines have a longer stroke than the other models listed. At the bottom of the stroke the piston skirt will strike on the bearing boss of the Crankcase Cover Assembly, P/N 57126 (Figure 1). As a result piston breakage and other damage to an MC-2 or MC-7 kart engine will occur.

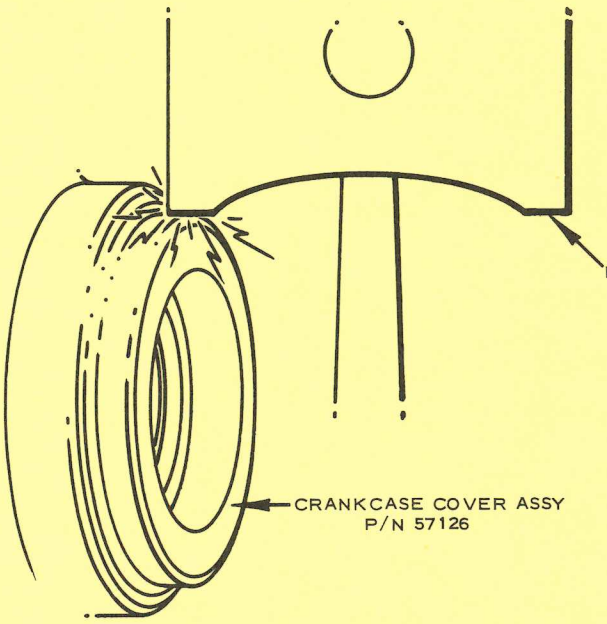


FIGURE 1

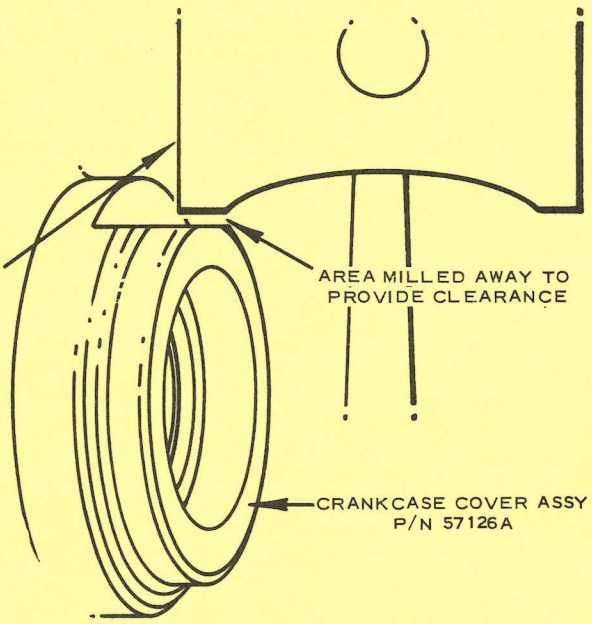


FIGURE 2

To prevent this, a new Crankcase Cover Assembly, P/N 57126A, which has a flat spot milled on the bearing boss (Figure 2) to give the piston necessary clearance at the bottom of the stroke, is available for service replacement on the MC-2 and MC-7 kart engines.

While the new Crankcase Cover Assembly, P/N 57126A, can also be used for service replacement on the MC-1, 1-42, 1-45, 1-52, and 1-62 engines, do not attempt to use Crankcase Cover Assembly, P/N 57126, on a MC-2 or MC-7 engine.

COPYRIGHT 1962 McCULLOCH CORPORATION

LITHO IN U.S.A.