McCULLOCH

SERVICE BULLETIN #1191


SUBJECT IMPROVING SWITCH BUTTON ACTION

MODEL 1-46, 1-53 DATE 8/31/62

At the top of the fan housing where the ignition switch is mounted on Model 1-46 and 1-53 engines, metal thickness and switch contact spring tension may combine to make the switch button difficult to move. This difficulty has been eliminated on current production models by inserting a Washer, P/N 100057, between the button and the contact.

Chain saws in the field which have this trouble may also be improved by adding the washer. To install it, remove the fan housing, the switch retaining screw, the stop-switch wire assembly, and the switch contact. Leave the switch base and the switch button in place.

As shown in the drawing below, place the Washer, P/N 100057, against the end of the switch button, then replace the switch contact, stop-switch wire assembly, and the retaining screw in the same order in which they were removed. Replace the fan housing.

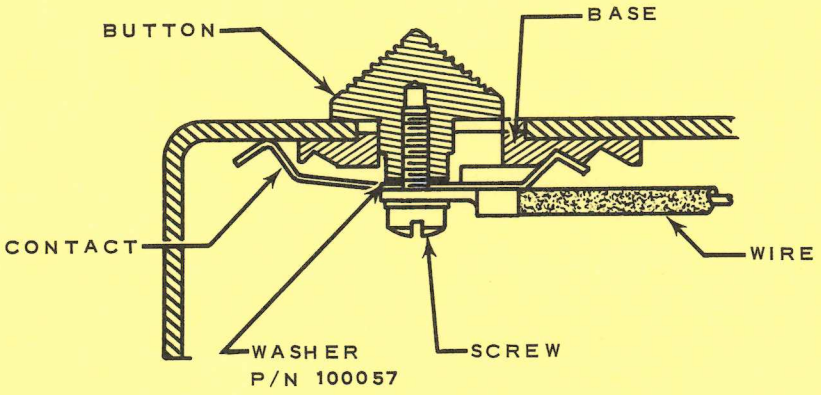

COPYRIGHT 1962 McCULLOCH CORPORATION

LITHO IN U.S.A.