McCULLOCH CORPORATION
SERVICE BULLETIN


1513

MODEL: MAC 10 Series January 7, 1972

SUBJECT: FLYWHEEL, P/N 61737A, REPLACED BY P/N 84681

We have received reports that flywheel, P/N 84681, does not fit (hits the coil lamination) when used as a replacement for flywheel, P/N 61737A.

Although P/N 84681 is .260 of an inch larger in diameter than P/N 61737A, it will fit in almost all cases without any modification to the coil lamination. In a few cases it may be necessary to file (use a 3/16" round) the slots in the coil lamination slightly to obtain the necessary .012 of an inch air gap between the flywheel magnets and the lamination.

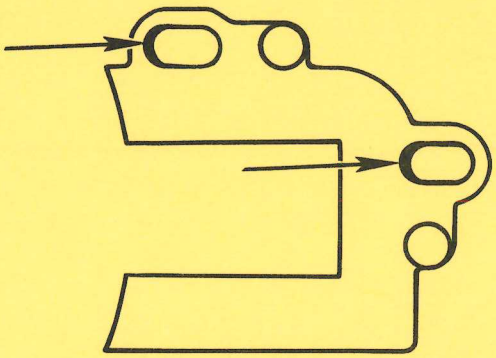

McCULLOCH CORPORATION

By Jack Carroll
Service Manager

Copyright 1972 by McCulloch Corporation

LITHO IN U.S.A.