# McCULLOCH CORPORATION
# SERVICE BULLETIN


1522

MODEL: Mini Mac 6,® 6A June 12, 1972

SUBJECT: OILER ROD AND PISTON MISALIGNMENT

It has been reported that the manual oiler rod on Mini-Mac 6 or 6A saws can slip off the upper end of the manual oiler piston as the oiler rod becomes worn.

A simple cure for this problem is the installation of a Screw, P/N 110445, into the rod end of the piston as shown. The screw head, being larger in diameter than the oiler piston provides a larger contact surface for the oiler rod.

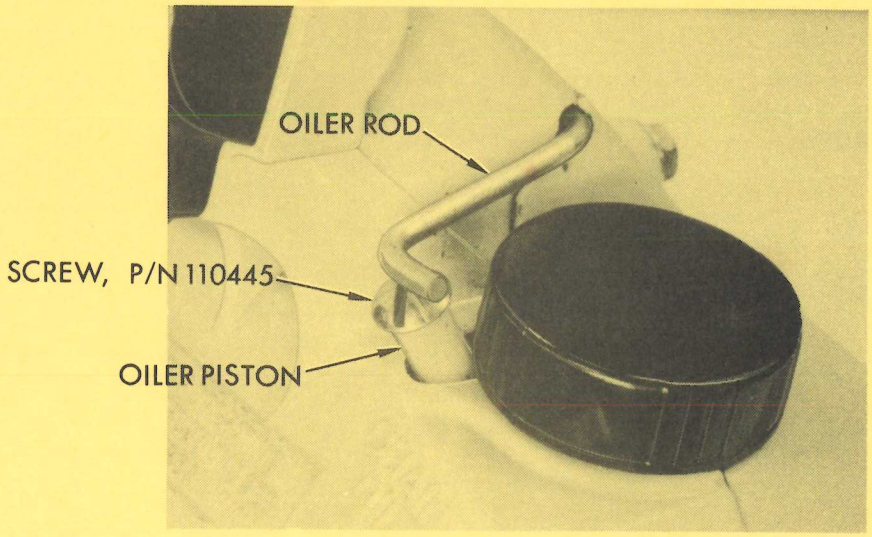


McCULLOCH CORPORATION

by Jack Carroll
Service Manager

Copyright 1972 by McCulloch Corporation

LITHO IN U.S.A.