McCULLOCH CORPORATION
SERVICE BULLETIN

1555

MODEL: Super 250, Super 550

April 17, 1974

SUBJECT: CLUTCH GUARD CLEARANCE

Lower frame screw holes are slightly mis-aligned in some of the frames used on Super 250 and 550 saws. This results in the outer frame arm being too close to the ends of the bar mounting bolts for removal or installation of the guard. See Figure 1.

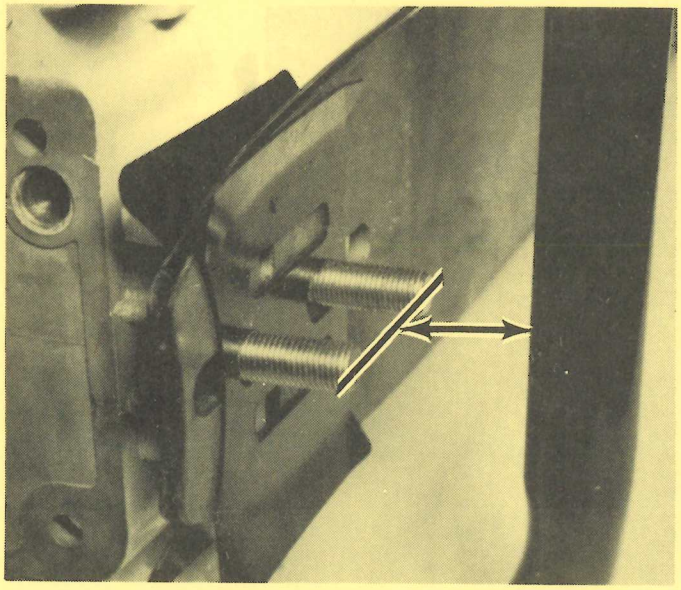


Figure 1.

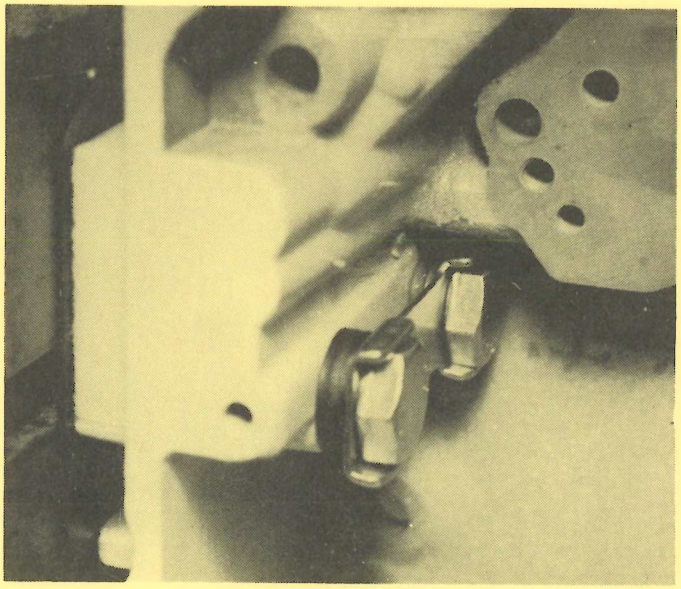


Figure 2.

Wherever necessary to correct this spacing problem, we have installed two Washers, P/N 84623, under each of the two bar mounting bolt heads as shown in Figure 2. Note that the washers are placed under the lockplate.

When making a bar bolt replacement on one of these installations, be sure to reinstall the washers as illustrated.

McCULLOCH CORPORATION

By Jack Carroll
Director, Product Service

Copyright 1974 by McCulloch Corporation

LITHO IN U.S.A.