McCULLOCH SERVICE BULLETIN


NO. 1598

MODEL Mini-Mac 25, 30, and 35 DATE February 20, 1976

SUBJECT Ignition Coil Ground Wire.

Reports about erratic engine performance have, in some cases, been traced to a poor ground for the ignition coil ground wire. This problem has shown up only on those units which have carburetor insulating sleeves and an insulating washer on the coil screws. Unless the wire is assembled so there is metal to metal contact between the screw and wire there is the possibility of a poor ground.

We recommend that this ground wire be assembled as shown in the illustration below to assure a positive ground.

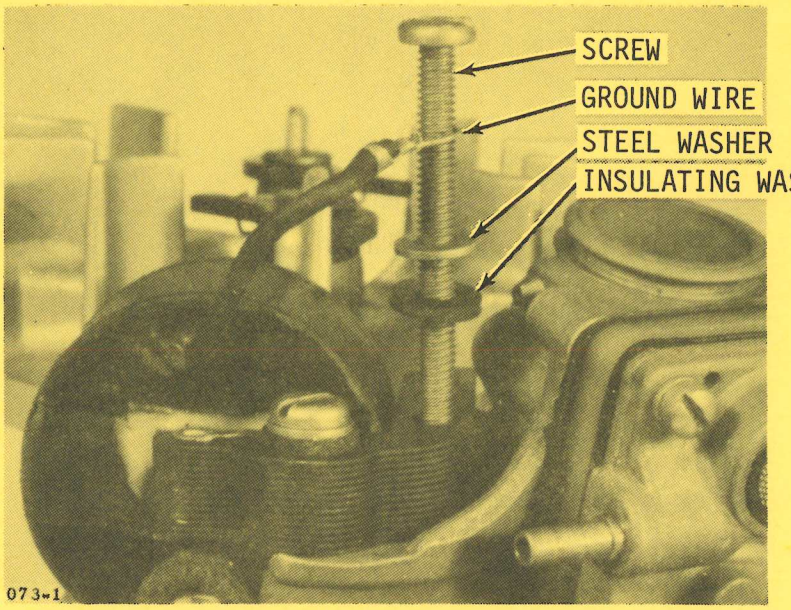

McCULLOCH CORPORATION

Product Service
Department

© U.S.A. 1976 – McCULLOCH CORPORATION
Printed in U.S.A.