McCULLOCH SERVICE BULLETIN

NO. 1609

MODEL All 10 Series Type Saws DATE July 1, 1976

SUBJECT 1. Service Replacement Connecting Rod Assemblies
2. Automatic Oiler Pad

1. SERVICE REPLACEMENT CONNECTING ROD ASSEMBLIES


Connecting Rod Assembly, P/N 65401, now has cap screws installed from the bottom (Fig. 1). This change has been incorporated to improve the locking characteristics of the screws.

Connecting Rod, P/N 65401, with screws installed from the bottom, will fit all 10-10 models, Prefix 12 and above.

DO NOT install Connecting Rod, P/N 65401, in the following models as there may be possible interference between cap screw head and crankcase bottom:

Models 1-10, 2-10, 3-10, 4-10, 5-10 and early production 6-10 series engines.

Connecting Rod Assembly, P/N 92802 (with cap screws installed from the top), must be used in above listed models (Fig. 2).

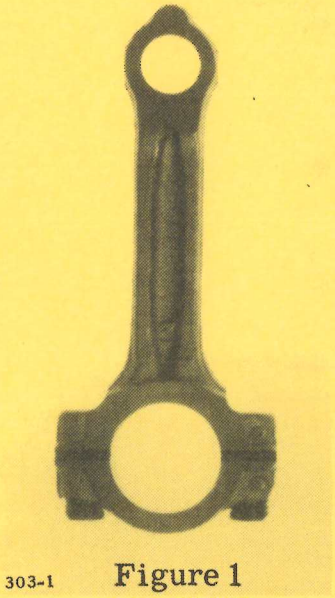

303-1 **Figure 1**
P/N 65401

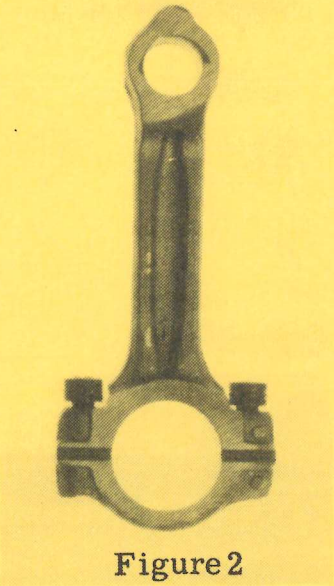


Figure 2
P/N 92802

2. AUTOMATIC OILER PAD

A Felt Pad, P/N 91259, has been added to the automatic oiler in all 10 Series chain saws. The pad reduces automatic oiler wear by stabilizing the adjustment sleeve.

McCULLOCH CORPORATION

Product Service
Department

© U.S.A. 1976 – McCULLOCH CORPORATION
PRINTED IN U.S.A.