McCULLOCH

SERVICE BULLETIN #1076


MODEL 1-80

DATE 10/29/59

SUBJECT CORRECT CLUTCH ROTOR REPLACEMENT

When replacement of the Clutch Rotor and Pawl Assembly, P/N 55717, is required on Model 1-80 saw engines, always install a new P/N 55717 Clutch Rotor and Pawl Assembly. Do not replace P/N 55717 with the earlier clutch rotor and pawl assembly, P/N 51836B (used only on 55 series engines).

The internal taper difference between the new 55717 and the earlier 51836B assemblies is too great and serious clutch damage will result if the 51836B rotor and pawl assembly is installed on Model 1-80 engines.

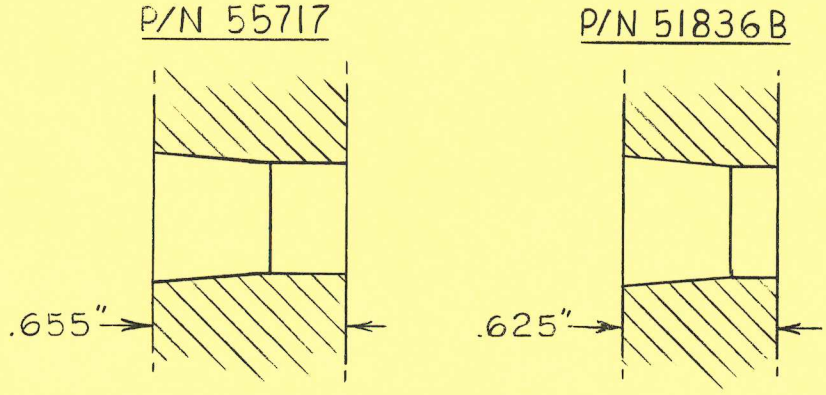

NOTE: P/N 55717, Rotor and Pawl Assembly, can be used on Model 1-80 and all 55 series engines.

P/N 51836B, rotor and pawl assembly, can be used only on all 55 series engines.

See Service Bulletin #1072 for additional clutch replacement information.

COPYRIGHT— 1959 McCULLOCH CORPORATION

LITHO IN U.S.A.