McCULLOCH

SERVICE BULLETIN # 1093A

MODEL **MAC D30, D36** DATE 5/11/60


SUBJECT **REPLACEMENT OF REED PLATE ASSEMBLY**

This Service Bulletin replaces Service Bulletin #1093.

Reed Plate Assembly, P/N 50747A, which is used on Model 1-40, 1-50, and 1-60 engines, has replaced the earlier reed plate assembly, P/N 50044, used on MAC D30 and D36 engines.


When installing 50747A Reed Plate Assembly on a MAC D30 or D36 engine, insert a new Foam Absorber, P/N 57457, into the crankcase third port cavity (see illustration below). The Foam Absorber increases horsepower by reducing engine resonance, prevents fuel puddling, and eliminates engine cut out at idle speed.

P/N 50747A

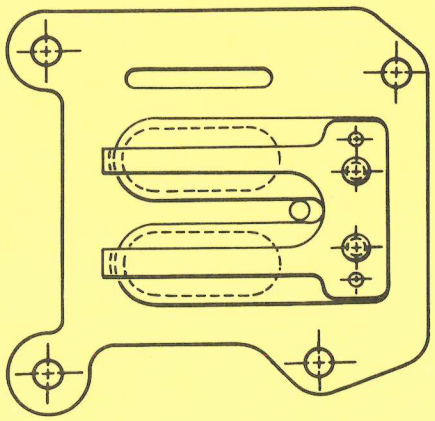


NEW REED PLATE ASSY
MAC D30 AND D36

P/N 50044

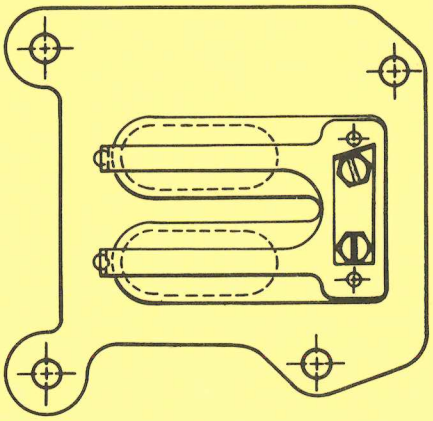

REPLACED REED
PLATE ASSY

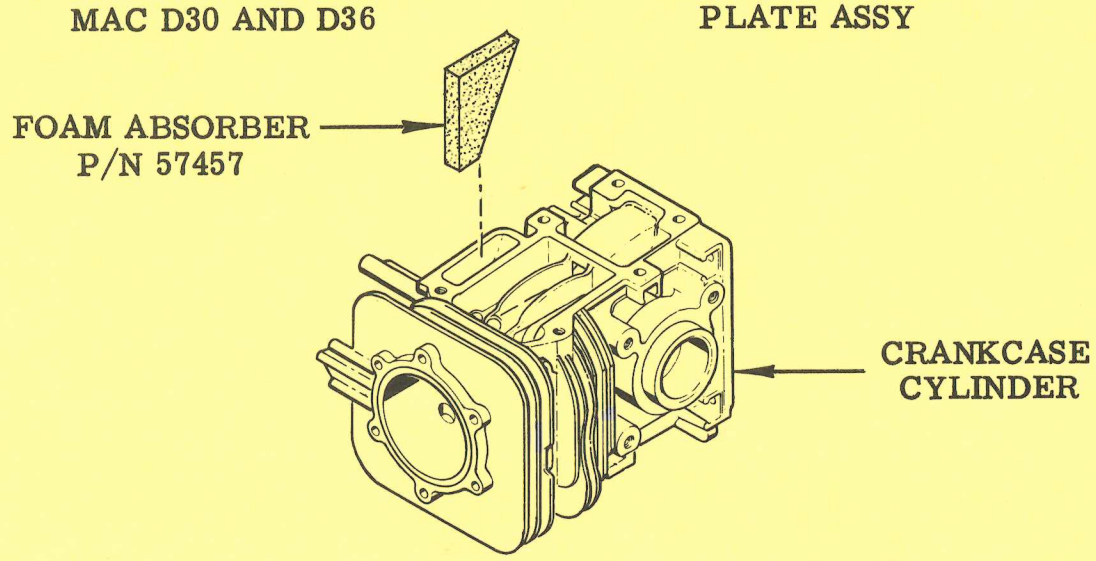

COPYRIGHT 1960 McCULLOCH CORPORATION

LITHO IN U.S.A.