McCULLOCH

SERVICE BULLETIN # 1187


SUBJECT **REPAIR OF AUTO-MAC BAR NOSE SPROCKET.**

MODEL **MISCELLANEOUS** DATE **7/17/62**

A service repair kit containing all necessary parts for replacement of the nose sprocket, hub and rollers of the AUTO-MAC Bar is available under P/N 59881.

The required service operation consists of removing the four old rivets, sprocket, hub and rollers from the nose of the bar. The new hub, rollers and sprocket are assembled outside the bar and slid into position between the bar sides. Four new rivets are furnished for riveting the hub into place. A detailed instruction sheet comes with each kit.

The kit can be ordered as AUTO-MAC Bar Repair Kit, P/N 59881 and has a manufacturer's suggested list price of $10.00.

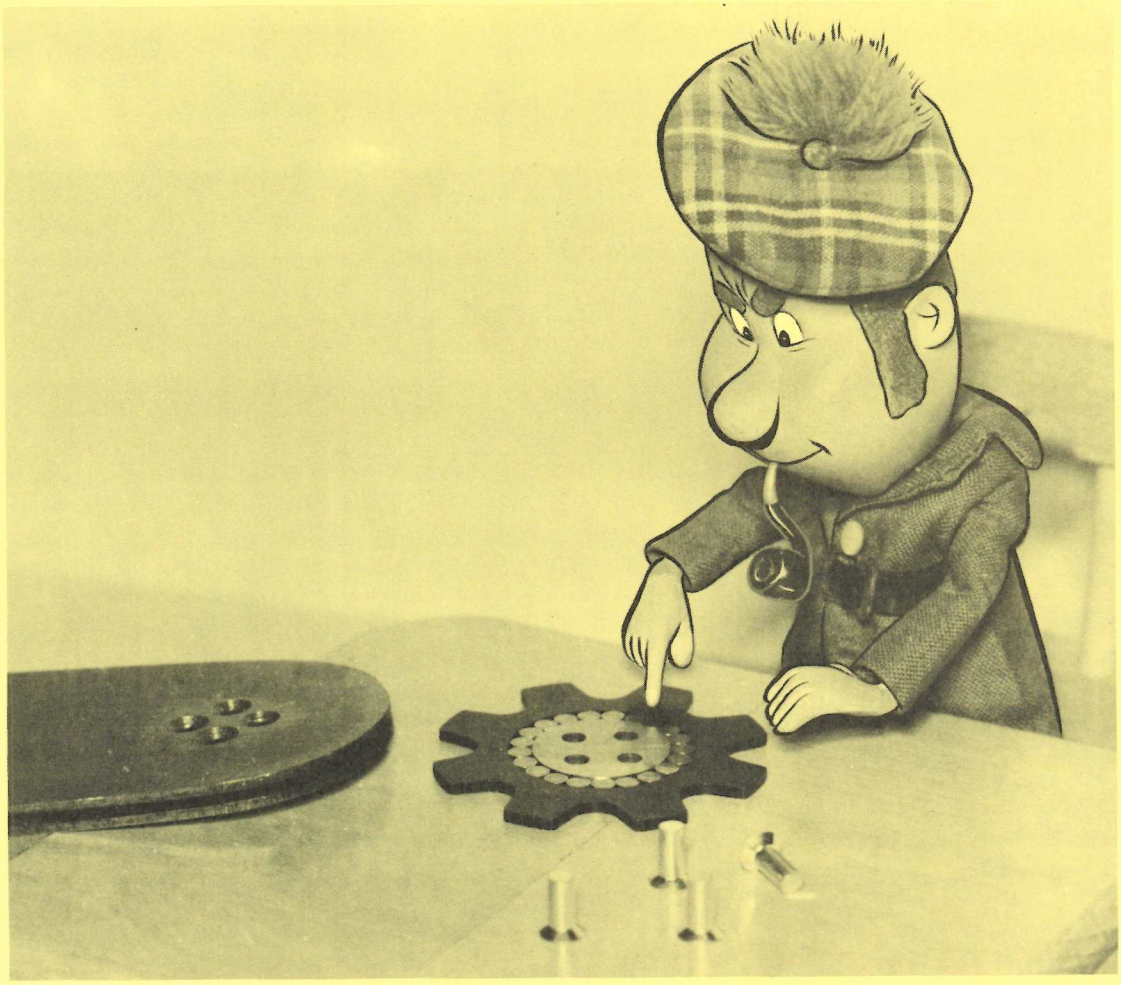

COPYRIGHT 1962 McCULLOCH CORPORATION

LITHO IN U.S.A.