McCULLOCH CORPORATION
SERVICE BULLETIN


1531

MODEL: MAC 10-10

January 18, 1973

SUBJECT: BAR BOLT INSTALLATION

Some crankcases on MAC 10-10 saws within the serial number range of 11-26801 to 11-33800, may have slightly modified bar mounting bolts (P/N 62065) installed on the saw. One side of the bolt head may have been filed to avoid interference by the rib section on the inside of the oiler tank, when the bolt was installed. See illustration below:

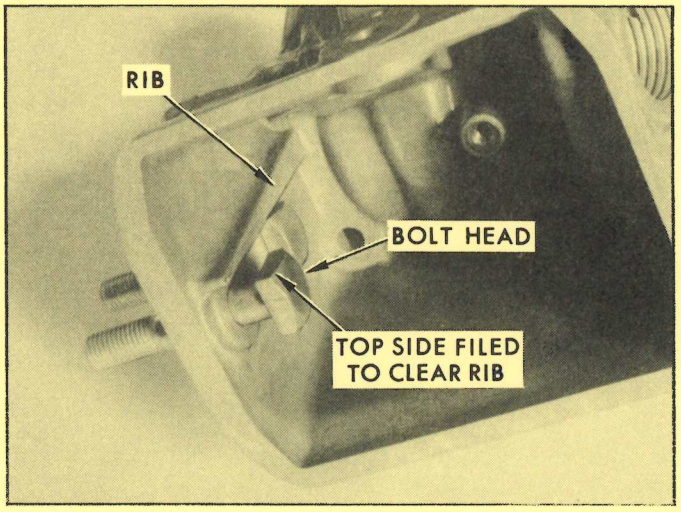

Note should be made of this possible condition so that if it becomes necessary to replace one or both bar bolts with filing evident, the replacement must also be filed. Inspection of the old bolt will tell if filing is necessary on the replacement, in which case, about 1/32 inch should be the maximum required.

McCULLOCH CORPORATION

By Jack Carroll
Service Manager

Copyright 1972 by McCulloch Corporation

LITHO IN U.S.A.