McCULLOCH SERVICE BULLETIN

NO. [redacted] 1666

MODEL Various

DATE June 12, 1978

SUBJECT 1. Corrections to ADV 140014-R6 Price List.
2. Spark Plug Thread Repair Kit, P/N 92125.
3. Flywheel Assembly, P/N 86068A (24-Fin).
4. Pro Mac 610/650 IPL Corrections.
5. Trigger Release Assembly, P/N 94275.

---

1. The following corrections should be made to the December 15, 1977 Master Parts Price List (ADV 140014-R6):


1. Page 3: Washer, P/N 24236, should have a manufacturer's suggested list price of $.10. This item will be available in "Z" packs at a list price of $1.00.

2. Page 15: Bearing - Ball, P/N 66016; the manufacturer's suggested list price has now been lowered to $7.00.

3. Page 30: Kit, Cylinder/Crankcase/Piston, P/N 92279, should have a manufacturer's suggested list price of $66.45.

---

2. Spark Plug Thread Repair Kit, P/N 92125, is now available for use on all McCulloch chain saws. This kit provides an excellent replacement thread at a relatively low cost per installation. Copper plated replacement inserts, for use with tapered seat and washer type spark plugs, are available for use with this kit.

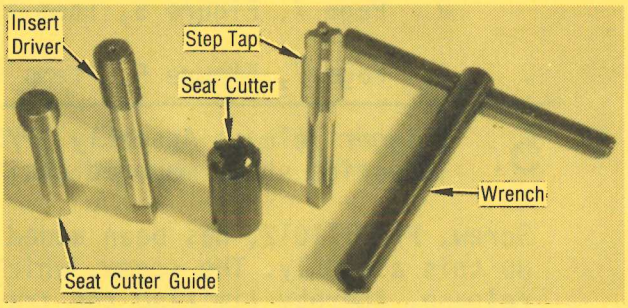

PART NUMBER	DESCRIPTION	MFG. SUGG. LIST PRICE	STOCK CODE
92123	Insert - 14mm Tapered seat (Pkg of 20)	10.20	A
92124	Insert - 14mm Flat seat (Pkg of 20)	7.50	A
92125	Kit - Spark plug thread repair	48.00	A


---


3. Flywheel Assembly, P/N 86068A, which includes a 24-fin flywheel, is now available as service replacement on Pro Mac 10-10, 555, 700 and 850 chain saws. The 12-fin and 24-fin flywheels can be used interchangeably on these 10-series models. However, the assembly components are not interchangeable with each other. The components must be used as follows:

	86068	Flywheel Assembly	86068A	
To be used only on P/N 86068 assembly	88804	. Screw - Special	93464	To be used only on P/N 86068A assembly
	67546	. Pawl - Starter	93198	
	83241	. Washer - Special	93469	
	67545	. Spring - Pawls	93197	

PRINTED IN U.S.A.

The manufacturer's suggested list price for Flywheel Asy, P/N 86068A, is $21.10.

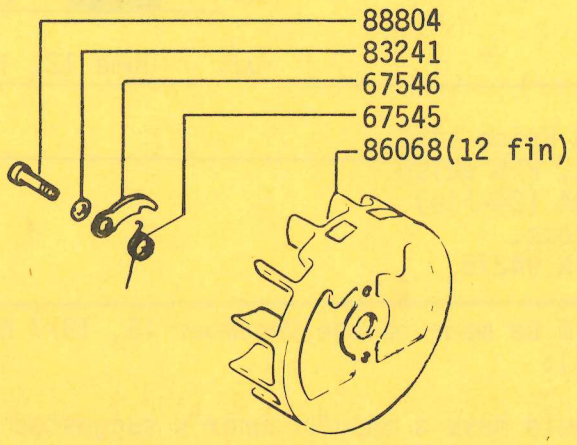

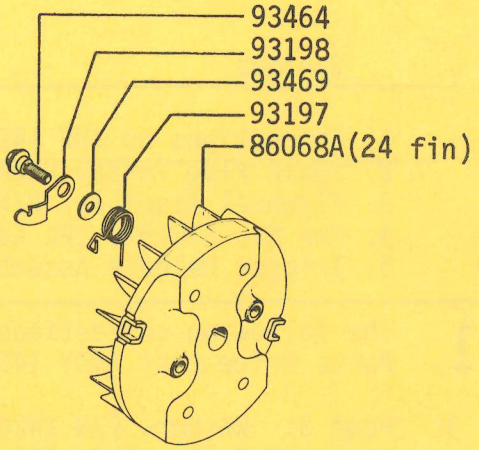

---

4. The following corrections should be made to the Pro Mac 610/650 Illustrated Parts List, P/N 93716-R1.

   1. Page 7, Figure 5, Item 45: change to P/N 62106, Screw-Wh hd 12-24 x 1-3/4.

   2. Page 7, Figure 5, Item 46: change to P/N 111025, Washer - Sealing.

   3. Page 7, Figure 5, Items 71 and 72: add footnote 1 to these items.

---

5. Trigger Release Assembly, P/N 94275, is now available for use on all 10 series shock mounted chain saws with safety triggers.

Screw, P/N 111012, has been added to Trigger Release, P/N 92153B, to make up this assembly. The screw, which extends the stop portion of the trigger release, thereby limiting the travel of the throttle trigger, is necessary for future PM 570 and PM 850 units. These units will have a shorter throttle rod which will facilitate achieving wide open throttle. No adjustment is necessary for this screw.

The manufacturer's suggested list price for this assembly is $.40.

McCULLOCH CORPORATION

Product Service Department