
SERVICE BULLETIN # 1010

SUBJECT Condenser Replacement

MODEL S-44 & S-55 DATE 1-9-58

In response to reports of difficulty experienced in replacing the condensers in Models Super 44 and Super 55 Saw Engines, the following procedure is suggested.

1. Remove breaker box cover.
2. Remove points-adjusting eccentric screw.
3. Remove breaker points assembly from breaker box by sliding pivot pin from bushing in rear of box.
4. Remove slot headed screw attaching lead connections to spring of breaker assembly.
5. Test condenser for continuity, resistance and capacity and replace if necessary.

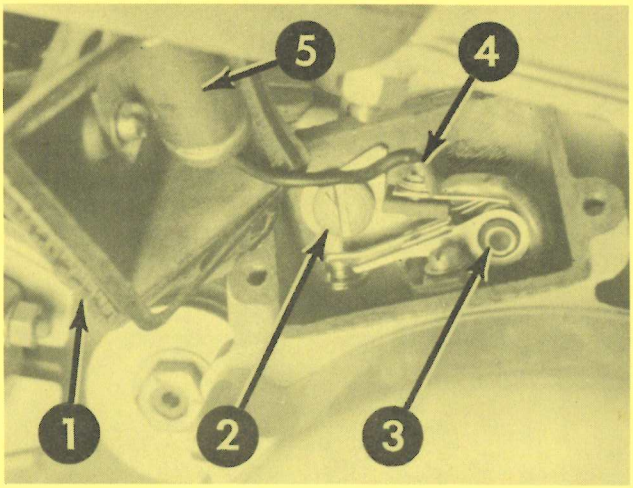

NOTE: It is also suggested that the breaker points be inspected and dressed if necessary before reinstalling assembly in breaker box.

6. Reverse above procedure and reset breaker points before replacing breaker box cover.

LITHO IN U.S.A.