
SERVICE BULLETIN #1015

McCULLOCH


SUBJECT: Bow Saw Oiler Tank Fitting. Short Shanks

MODEL: MAC 35 DATE: 2-28-58

The shank of the Bow Saw Oiler Tank fitting, part number 36349, was shortened to fit the oiler tank of some MAC 35's in which the oiler castings were drilled shallow. Use of the fitting in the field showed that it could not function properly with the short shank. Consequently all short shank fittings, part number 36349, should be replaced with the long shank fittings of the same part number. Credit will be given for all short shank fittings returned to factory. Use Parts Return Request.




SHORT SHANK

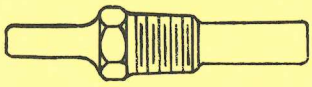

LONG SHANK

If difficulty is experienced in installing the long shank fittings on MAC 35 Oiler Tank, part number 36125, the oiler fitting hole in the tank should be drilled with a "D" size (.246 inch diameter) to a depth of .82 inch.

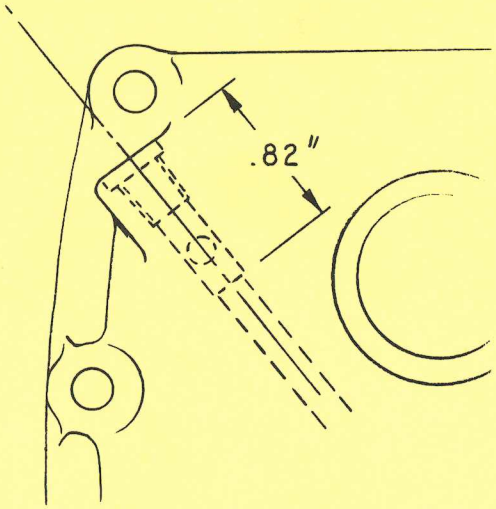

LITHO IN U.S.A.