McCULLOCH


SERVICE BULLETIN #1074

SUBJECT CLUTCH SHOE DAMAGE

MODEL 1-80, 55 Series DATE 9-22-59

When using the clutch puller tool to remove the clutch assemblies which contain the new cast iron shoes, do not jam the clutch puller attaching screws against the cast iron shoes. If the screws are jammed against the cast iron shoes, the shoes may be damaged or broken.

To avoid jamming the clutch puller attaching screws, gently turn-in the screws until you feel them bottom against the clutch shoes. Then, back them off one full turn and remove the clutch assembly in the usual manner.

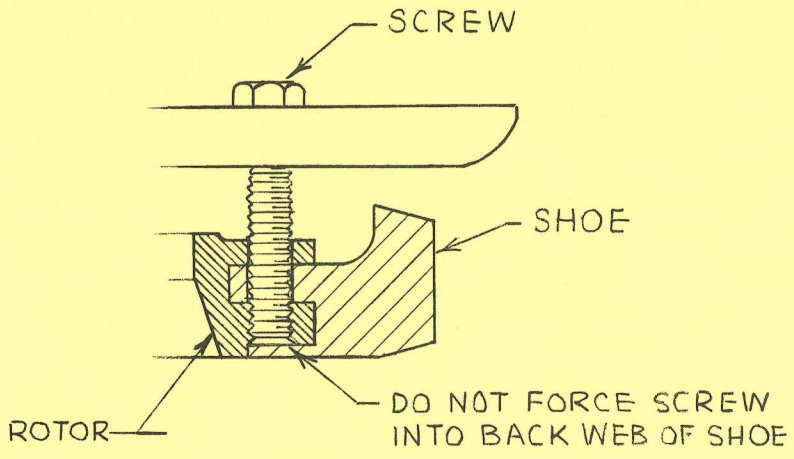

COPYRIGHT— 1959 McCULLOCH CORPORATION

LITHO IN U.S.A.