McCULLOCH CORPORATION
SERVICE BULLETIN


1567

MODEL: Mini-Mac and Power Mac 6

July 27, 1974

SUBJECT: Sprocket and Drum Kit, P/N 90150, Bearing Installation Change.

Sprocket and Drum Kit, P/N 90150, is now being assembled with the bearing pressed inboard to bring the centerline of the sprocket over the center of the bearing. This allows the bearing to protrude .050 to .060 inch (1.27 to 1.52 mm) from the face of the sprocket.

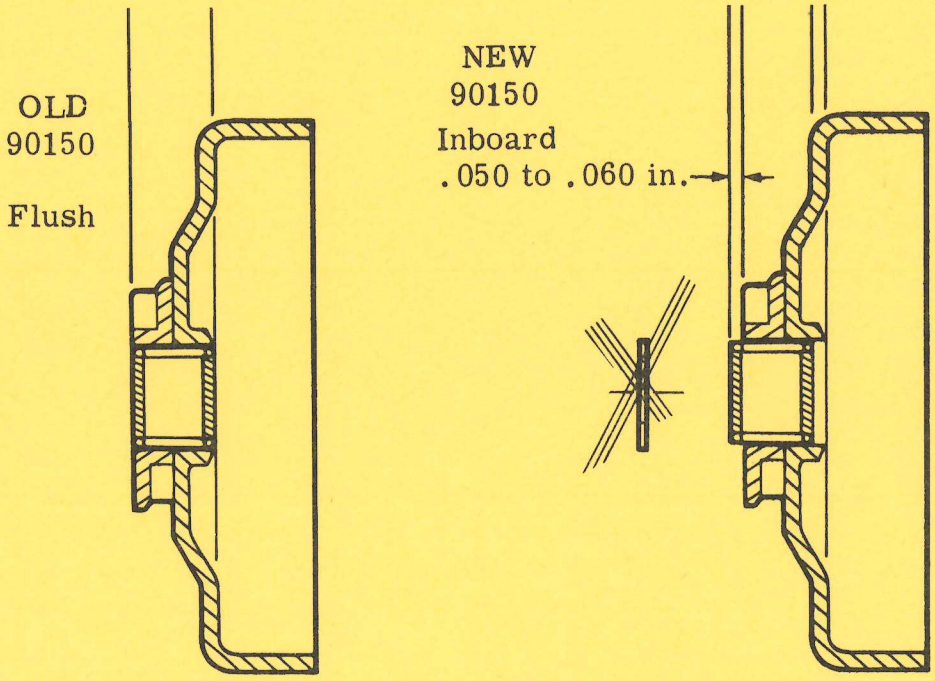

A sprocket washer is not required when the extended bearing kit is installed. Any washer previously used should be discarded.

NOTE: Approximately 300 kits have been shipped with instructions to install the sprocket washer. With installation of the extended bearing assembly however, these instructions no longer apply.

Copyright 1974 by McCulloch Corporation

LITHO IN U.S.A.